


Cod. 746F4

PIASTRINE DI AGGIUSTAGGIO PER STAMPI

Acciaio: Da cementazione 58-60 HRC (cuore 45 HRC)

Esempio di ordinazione : Codicea

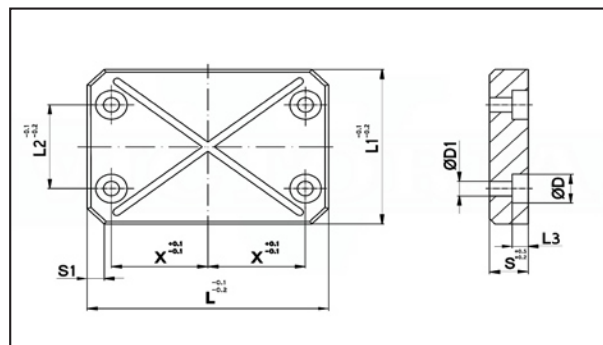


Codice	L	L1	S	X	L2	D	L3	D1	S1		
746F4-PST-C007	140	100	13.1	50	30	15	9	9	10	•	
746F4-PST-C008	100	100	13.1	30	30	15	9	9	10	•	
746F4-PST-D016	100	150	10.1	-	60	11	7	7	14	•	
746F4-PST-D017	100	200	10.1	30	90	11	7	7	14	•	
746F4-PST-D018	100	250	10.1	30	90	11	7	7	14	•	

Cod. 746T

PIASTRINE DI AGGIUSTAGGIO PER STAMPI

Acciaio: Da cementazione 58-60 HRC (cuore 45 HRC)

Esempio di ordinazione : Codice

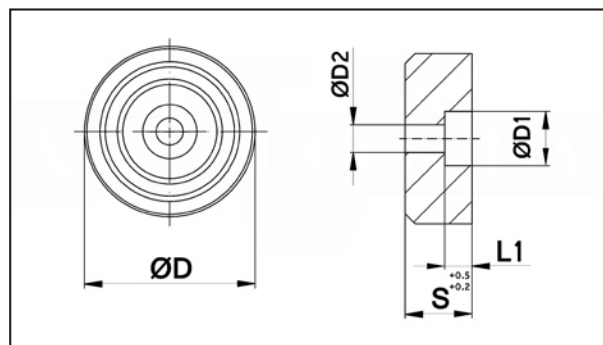

Codice	D	S	D1	L1	D2		
746T-PST-R001	30	10.1	12	7	7	•	
746T-PST-R002	40	10.1	12	7	7	•	
746T-PST-R003	50	10.1	12	7	7	•	
746T-PST-R004	60	10.1	12	7	7	•	
746T-PST-R005	70	10.1	12	7	7	•	
746T-PST-R006	80	10.1	12	7	7	•	
746T-PST-R007	90	10.1	12	7	7	•	
746T-PST-R008	100	10.1	12	7	7	•	
746T-PST-S001	20	13.1	12	7	7	•	
746T-PST-S002	30	13.1	12	7	7	•	
746T-PST-S003	40	13.1	12	7	7	•	
746T-PST-S004	50	13.1	12	7	7	•	
746T-PST-S005	60	13.1	15	9	9	•	
746T-PST-S006	70	13.1	15	9	9	•	
746T-PST-S007	80	13.1	15	9	9	•	
746T-PST-S008	90	13.1	15	9	9	•	
746T-PST-S009	100	13.1	15	9	9	•	
746T-PST-T001	20	18.1	12	7	7	•	
746T-PST-T002	30	18.1	12	7	7	•	
746T-PST-T003	40	18.1	12	7	7	•	
746T-PST-T004	50	18.1	12	7	7	•	
746T-PST-T005	60	18.1	17	11	11	•	
746T-PST-T006	70	18.1	17	11	11	•	
746T-PST-T007	80	18.1	17	11	11	•	
746T-PST-T008	90	18.1	17	11	11	•	
746T-PST-T009	100	18.1	17	11	11	•	